## **INSPECTION REPORT**

TYPE:

**INSPECTOR:** 

**OWNER'S NAME:** 

**PERMIT NUMBER:** 

TIME STARTED:

DATE:

BP-13-00703

1/21/2015

11:47 AM

**BERTEIG** 

Jeremy Haberman

Framing

MAP NUMBER: 19-16-02000-0007					
1. DWV H2O Test OK.					
2. Supply Test OK. 65#/15 Min.					
3. Install header over powder bath window.					
4. Install top plate strap at outlooker glulam beam in main floor bedroom.					
5. Truss sheets not onsite.					
6. Unable to verify clips referenced in engineer letter at post to beam connection in prow					
wall.					
7. Porch framing not per plan, remove portion of porch soffit for framing inspection.					
8. Entry Door header needs to be 4x8.					
9. 4x6 header required at entry to main floor bedroom.					
10. Basement wall raised sill plate requires engineer approval.					
11. Point load squash blocking not complete.					
12. Deck Ledger not per plan. Addtional bolting required.					
INSTRUCTIONS: Complete Corrections Above. Do not insulate.					
NEXT INSPECTION: Re-Inspection					
RE-INSPECTION FEE DUE? VES \$					
IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION					
QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:					
jeremy.haberman @co.kittitas.wa.us					
<ul> <li>INSPECTION REQUEST LINE: <a href="www.co.kittitas.wa.us/cds/request.asp">www.co.kittitas.wa.us/cds/request.asp</a> or 509-962-7694</li> <li>411 N. Ruby Street, Suite 2, Ellensburg, WA 98926</li> <li>Main Office Line: 509-962-7506</li> </ul>					

## **INSPECTION REPORT**

PERIVITI NUIVIBER:		BP-13-00703	OWNER'S NAIVIE:	BERTEIG		
DATE:		1/21/2015	TYPE:	Framing		
TIME STARTED:		11:47 AM	INSPECTOR:	Jeremy Haberman		
MAP NUMBER:		19-16-02000-0007				
	Page 2					
	13. Deck	joists not per plan.				
	14. Deck joist hangers not ZMAX.					
	15. 4x6 Header required at linen storage hallway.					
	16. Gas line OK. 15#/15 Min.					
	17. At exterior wall parallel to floor joist solid 2x blocking required per detail 1/A9.0					
	18. Clips per 2/A9.0 at joist.					
	19. Fireplace framing not complete.					
	20. Verify anchor bolt spacing at shearwall 4s. Missing nut in downstairs bedroom.					
	21. 2x6 wall studs at tall concrete wa II require 1/2" seperation.					
INSTRUCTIONS: Complete Corrections Above. Do not insulate.						
NEXT INSPECTION: Re-Inspection						
RE-INSPECTION FEE DUE? VES \$						
IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION						
QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:						
	jeremy.haberman @co.kittitas.wa.us					
<ul> <li>INSPECTION REQUEST LINE: <a href="www.co.kittitas.wa.us/cds/request.asp">www.co.kittitas.wa.us/cds/request.asp</a> or 509-962-7694</li> <li>411 N. Ruby Street, Suite 2, Ellensburg, WA 98926</li> <li>Main Office Line: 509-962-7506</li> </ul>						