INSPECTION REPORT

PERMIT NUMBER: BP-15-00165 OWNER'S NAME: BV RESORT HOMES

DATE:		10/8/2015	TYPE:	Floor framing		
TIME S	TARTED:	1:13 PM	INSPECTOR:	Jeremy Haberman		
MAP N	IUMBER:	20-15-19051-0032				
	1. Floor Joist	: Not Adequetely Bear on Found	lation. IRC 2012 R	502.6 Bearing. The ends of e		
	ach joist, beam or girder shall have not less than 1.5 inches (38 mm) of bearing on wood o					
	r metal and not less than 3 inches (76 mm) on masonry or concrete except where supported o					
	n a 1-inch by 4-inch (25.4 mm by 102 mm) ribbon strip and nailed to the adjacent stud or b					
	y the use of approved joist hangers.					
	2. Contact of Non Pressure Treated Joist to Concrete in Several Locations. Barrier Missing					
	3. Foundation Wall Does Not Adequately Sit On Footing on West Edge of Struture. Appears W					
	Il extends Past Footing and Wall Pour Extends Directly to Bearing with Soil. Provide Engin					
	eers OK.					
	4. Pier Pads Under 4x4 Posts Not Adequate Dimension in Several Locations. Appears Pads w					
	e cut/split and Relocated. Provide Engineers OK.					
	5. Under Floor Shearwall Not Adequately Connected to Strip Footing. Provide Engineers OK.					
INSTRUCTIONS: DO NOT SHEET FLOOR. Make Corrections Above.						
NEXT INSPECTION: Re Inspect.						
RE-INSPECTION FEE DUE? VES \$						
IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION						
QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:						
ieremv.haberman @co.kittitas.wa.us						
 INSPECTION REQUEST LINE: www.co.kittitas.wa.us/cds/request.asp or 509-962-7694 411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 Main Office Line: 509-962-7506 						

INSPECTION REPORT

PERMIT NUMBER:	BP-15-00165	OWNER'S NAME:	BV RESORT HOMES			
DATE:	10/8/2015	TYPE:	Floor framing			
TIME STARTED:	1:13 PM	INSPECTOR:	Jeremy Haberman			
MAP NUMBER:	20-15-19051-0032					
Page 2						
6. Mud Sill F	6. Mud Sill Plate Notches Compromise Attachment to Foundation. Provide Engineers OK.					
7. No Uplift/	7. No Uplift/Positive Connection of Floor Joists to Beam Pocket. Joists Move Lateral and V					
ertical	ertical					
8. NOTE: PI	8. NOTE: PHOTOS ON "T" DRIVE					
INSTRUCTIONS: DO NOT SHEET FLOOR. Make Corrections Above.						
NEXT INSPECTION: Re Inspect.						
RE-INSPECTION FEE DUE? VES \$						
IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION						
QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:						
ieremv.haberman @co.kittitas.wa.us						
 INSPECTION REQUEST LINE: www.co.kittitas.wa.us/cds/request.asp or 509-962-7694 411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 Main Office Line: 509-962-7506 						